

Known bugs and limitations in Prinergy Workflow 9.0

This section lists bugs and limitations that are known to exist in the software. If a future version of the software resolves a bug listed here, the bug is moved to the Fixed bugs section of the release notes accompanying that version of the software.

Limitations that are new to Prinergy 9.0:

The Mac M1 chipset has limited supported at this time. Please see the "*Supported client workstations*" section of these Release Notes.

Some free "Internet fonts" can cause issues

Malformed Fonts that do not follow strict specifications (typically found for free on the Internet) may cause issues on refine and or output. Proof carefully if using these types of fonts.

Using a Preflight+ check such as "List Potential Font Problems" is sometimes a good way to mitigate this risk.

Dashboard has been removed in Prinergy 9.0 and is no longer supported

With the end of support for Adobe Flash, Dashboard is no longer available in Prinergy. Dashboard functionality is migrating to the PRINERGY On Demand portal. See PartnerPlace answer ID 75256 for more information.

Setup client interface is no longer available in macOS Workshop client

The Setup client interface has been removed from the Prinergy Workshop client on macOS due to Silverlight End Of Service Life by Oct. 12, 2021. Setup continues to be available with the Windows Prinergy Workshop client.

PDF Editor Adobe Illustrator Plugin is no longer installed as of Prinergy 9.0

Tiff Direct Output fails when making on-the-fly Process Template edits - PRINERGY-52304 - Addressed by P9.0.0.3. [See Available Patches.](#)

Big Sur (11.0) support

The shortcut **WorkshopInstaller** does not work properly. If you double-click it, Workshop will not be installed.

Workaround

1. Connect to the wkspInstall share on the server.
2. Within the share, navigate to MacOSX>Disk1>InstData
3. Double-click the **WorkshopInstaller** application to begin the installation.

(PRINERGY-49418, PRINERGY-49597)

- **Preps 9.0.0** is not supported on Big Sur.

Active Directory support via Patch P9.0.0.2

Note: Limitation is applicable to Prinergy servers within an active directory domain

- Users must include their domain within the login - eg: Domain\Username
- Currently a new user props file is created when a domain user logs into Workshop. This results in the loss of a user's visible column selections and process template favourites. Workaround: Service Team will roll-back the patch and manually apply patch(es) (PRINERGY-52502)
- Workshop search is not functioning with the AD Support patch. Workaround: Service Team will roll-back the patch and manually apply patch(es) (PRINERGY-52506)


VPS+

- VPS+ cannot view the front and back of an imposition at the same time, sides can only be viewed individually
- Resolution of images at certain zoom percentages is not as sharp as VPS "Classic"
- Speed when changing zoom levels is not as fast as VPS "Classic". This is because VPS Classic pre-renders a limited set of zoom levels. VPS+ currently allows any zoom percentage, but you pay a price in terms of speed for this flexibility. Future versions of VPS+ will adopt pre-rendered views to improve performance.
- VPS+ is only installed on Macintosh OS 10.15 and higher systems. Windows and Mac clients prior to 10.15 will remain with VPS Classic until current VPS+ limitations are resolved.

Preps 9.0.0

Assembly View, Press Runs View and Textmarks are blurry on MAC workstations with specific graphics card - FIXED in Preps 9.0.1 (coming soon)

- **Workaround for Preps 9.0.0** - change Built-in Retina Display/Color to "**Apple RGB**".

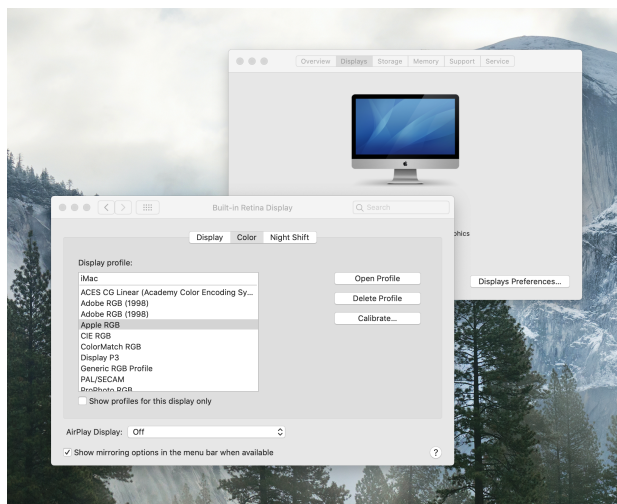

The following graphics cards are known to be affected:

Radeon Pro Vega 56
Radeon Pro 580x
Radeon R9 M390
Radeon Pro 5300
Radeon Pro 5300M/Intel UHD 630
Radeon Pro 5300 XT
Intel Iris Plus Graphics 1536 MB

Limitations relevant to Prinergy 9.0 and previous versions:

The Mac M1 chipset is not officially supported at this time.

macOS Mojave (10.14), Catalina (10.15) support

- The shortcut **WorkshopInstaller** does not work properly. If you double-click it, Workshop will not be installed.

Workaround

1. Connect to the WkspInstall share on the server.
2. Within the share, navigate to MacOSX>Disk1>InstData
3. Double-click the **WorkshopInstaller** application to begin the installation.


(PRINERGY-49418, PRINERGY-49597)

Managed Services - Line Extension License entitlement

The current Managed Services entitlement under the Line Extension License feature may not be reflected in the number of JTPs you are licensed for on your Prinergy Primary. Version 9.0.0 is currently limited to a maximum of seven trapper JTPs and 15 Register JTPs.

Digital Job Ticket Editor

- In Windows, when using Digital Job Ticket Editor from within Workshop to edit a job ticket, it is intended to behave as a modal window, that is, it should prevent interactions with other elements of the Workshop client user interface until you have completed your interaction with Digital Job Ticket Editor. The current behavior on Windows is non-modal and incorrectly allows other elements in the Workshop client to be edited while Digital Job Ticket Editor is open. Therefore, it is not recommended to do anything in Workshop until you have finished using Digital Job Ticket Editor (clicking **Submit** or **Cancel**). [PRINERGY-40231]
- When using Digital Job Ticket Editor from within Workshop (**Send to Digital** command) or when opening Device Track from the Workshops **Tools** menu, the **Measurement Unit** defined in Workshop's Preferences is used and the **Weight Unit** and **Thickness Unit (Caliper)** are taken from Setup's Preferences.
When Device Track is opened on the web (not from within Workshop), all unit settings in Digital Job Ticket Editor are taken from Setup's Preferences. [PRINERGY-42049]
- Settings available In RBA are not necessarily relevant to all digital devices. If you set a parameter which is not relevant for the selected device, this setting will be ignored when the rule is executed.
- Digital Job Ticket Editor can only display substrates in the **Substrate** drop down list that have sizes assigned. If a user creates a substrate on the digital device that lacks a defined size, it will not be sent to Prinergy and will not appear in Prinergy's Job Ticket Editor. [PRINERGY-46624]
- Digital Job Ticket Editor's **Substrate** drop down cannot display two substrates with the same name. If a user defines two substrates with the same name and size only one of them will be appear in Job Ticket Editor. [PRINERGY-46624]
- Commas are not supported as a decimal separator in the Job Ticket Editor. To change the number format, open the Region control panel and press the Additional Settings button. When the Customize Format window appears, select the Numbers tab and make sure that the Decimal symbol is set to a period (.).

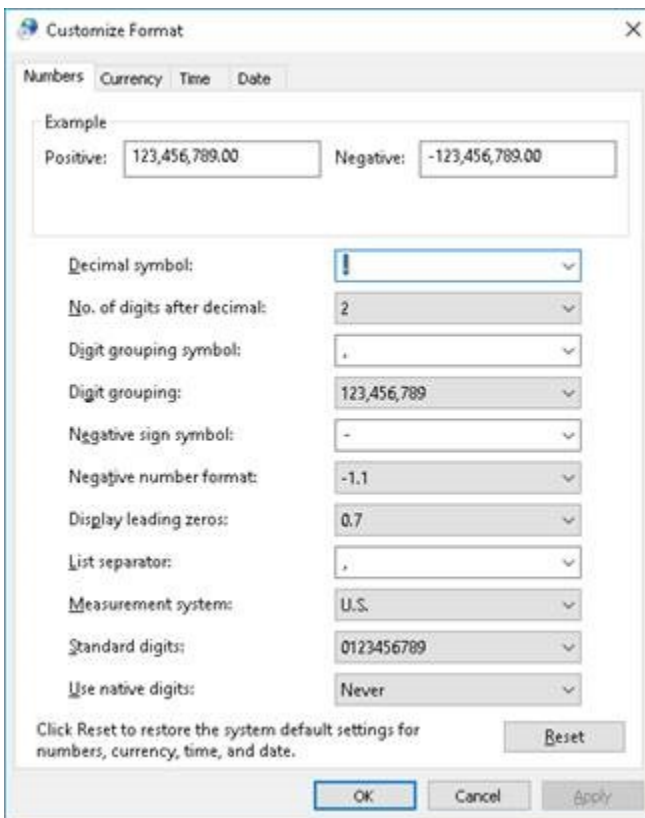

Device Track

- In order for Device Track to operate correctly within Internet Explorer 11, the setting **Display intranet sites in Compatibility View** must be disabled. This setting is enabled by default.
To change the Compatibility View setting, in Internet Explorer, from the **Tools** menu, select **Compatibility View Settings**, and in the Compatibility View Settings dialog box, clear the **Display intranet sites in Compatibility View** check box, and click **Close** to apply the change. [PRINERGY-41259]
- In Internet Explorer 11, when you use the Refresh button in the browser to refresh Device Track, sometimes the data displayed is the data saved in its cache and not the data from the server.
- When using Internet Explorer with Device Track, Device Track requires version 11 or later. [PRINERGY-41757]
- Resizing columns in Device Track may result in columns being pushed off screen. [PRINERGY-41180]
- An issue with status reporting coming from Kodak Xpo can cause the **In Process** queues in Prinergy's Device Track UI and Xpo to get out of sync and display output separation in the wrong order in Device Track. [PRINERGY-47843]
- After successful completion of output to EFI or Canon digital front-ends, the completed output jobs are absent from all queues in Device Track. [PRINERGY-47923] [PRINERGY-43780]
- In some older versions of EFI Fiery software, the number of inks reported was limited to five. This would cause jobs with more than five colors to incorrectly limit their color reporting back to Prinergy's Device Track UI to five colors. [PRINERGY-46698]

- When resubmitting a separation via Device Track, the separation receives a new Job ID from the device control software (Xpo or Print Console). This is due to the separation being treated as a new output instance rather than a remake of a previous output.
- Incomplete Notification Messages on Prinergy 9.0 Track with Print Console 5.16 [PRINERGY-52855]
- Device messages prompt on Print Console 5.24 do not pop up on Prinergy 9.0.2 TRACK > Device Messages Window [PRINERGY-52855]

TIFF Direct CTP connectivity

- When resubmitting a job to Print Console, two instances of the job will appear in the Print Console queue. The original job will include a note indicating it was removed by a Prinergy Workshop client, but still appears in the list. The second instance is the resubmitted job. [PRINERGY-46206]
- When adding a new media configuration, such as a new plate size, to a CTP output device, there is a delay of about one minute between adding it to the device and the new media appearing in Prinergy Workflow's UI via the new TIFF Direct connectivity. [PRINERGY-46439]
- When adding or removing punch settings on a CTP device, the status change is not communicated to Prinergy Workflow. If you add or remove a punch from a CTP device, you must disconnect the device from the Prinergy Administrator (UADM) and reconnect it to refresh the punch status. [PRINERGY-46404]
- The **Cut Media** check box in the **Device** section of the final output process template is not supported by Xpo and Print Console and should not be selected. [PRINERGY-46874]
- The **Punch Setting** list contains all available punch settings for the selected device. When you select a punch setting, make sure you select a punch that is compatible with the selected media.
- VMR (Variable Mainscan Resolution) imaging is not supported with Xpo. [PRINERGY-47187]
- VMR (Variable Mainscan Resolution) imaging is not supported with Print Console. [PRINERGY-47338]
- When using a slugline mark with the updated sluglinemark positioning settings in the process template with direct (GDAPI) and TIFF Direct connectivity to CTP devices, the slugline mark may appear in the wrong location on the plate. [PRINERGY-46463]

CTP connectivity

- When using a slugline mark with the updated sluglinemark positioning settings in the process template with direct (GDAPI) and TIFF Direct connectivity to CTP devices, the slugline mark may appear in the wrong location on the plate. [PRINERGY-46463]
- When adding or removing punch settings on a CTP device, the status change is not communicated to Prinergy Workflow. If you add or remove a punch from a CTP device, you must restart the JTP and define a new process template. [PRINERGY-46404]

Setup

- Due to limitations in third-party JDF implementation, some settings may not flow back to Prinergy Workflow's Setup application when updated in the front end software. This can include: binding edge, maximum density, layout, and sheet size options. [PRINERGY-39050] [PRINERGY-39982] [PRINERGY-40039] [PRINERGY-40045] [PRINERGY-41511] [PRINERGY-41632] [PRINERGY-41732] [PRINERGY-41745] [PRINERGY-41836] [PRINERGY-41906]

- Setup may have problems being installed via Microsoft Edge and Google Chrome. To install Setup via Microsoft Silverlight with Microsoft Edge, see the following support article from Microsoft: <https://support.microsoft.com/en-us/help/17472/windows-internet-explorer-11-fix-site-display-problems-compatibility-view#ie=ie-11>. [PRINERGY-41686]
If you are having problems installing via Chrome, use a different browser. [PRINERGY-41032]
- Setup cannot be installed via Firefox on Mac OS X 10.12 because Firefox on Mac OS X 10.12 does not support Microsoft Silverlight. Use a different browser to install and to start Setup. [PRINERGY-44565]
- If you try to import substrates and/or reload device capabilities (in Setup > **Equipment** > **Digital Device**) from a connected press or DFE while this device is down, the substrates and/or device settings will no longer be visible in the Digital Job Ticket Editor when you submit a job. Once the device is up and running, you must re-import the substrates and/or reload the device capabilities so that they are visible again in the Digital Job Ticket Editor. [PRINERGY-45261]
- Setup is not localized with Chinese and Japanese on macOS Sierra (version 10.12) and macOS High Sierra (version 10.13) because of missing fonts. [PRINERGY-46365]
To solve this issue, install the missing fonts:
 1. MS Gothic.ttf -> for Japanese
 2. .ttf -> for Chinese
- Setup cannot be installed on macOS workstations with Safari 12 installed. If you use Setup to configure items like Digital Press settings on your Prinergy server, we suggest delaying updating Safari to version 12 until Prinergy has been officially qualified with Safari 12.[PRINERGY-49332]

Job search

- In Job Finder, in the job advanced search feature, the search fails if you use the **is not** operator with a numerical value. [PRINERGY-38941]
- In Job Finder, in the job advanced search feature, if you select **Any**, the search results contain both jobs and pre-jobs that match the defined search criteria. [PRINERGY-39664]

Integration with ColorFlow

The following limitations have been identified for using the ColorFlow software with Prinergy:

- Pages added to a ColorFlow-enabled job using Prinergy's Bypass Refine will have undefined Color Setup. This is expected behavior. Refining with ColorConvert enabled is recommended with ColorFlow integration.
- If you attempt to output a file with a different snapshot number from the number you defined in the refine process template, an error message appears.

ColorConvert

The following ColorConvert problems have been identified:

- Color matching certain files with transparent objects can result in significant changes in appearance. The problem is file specific and is dependent on the transparency blending modes applied, the object's color and the DeviceLink or ICC profile used to colorconvert the objects. The problem occurs because each graphic and image object used in the transparency group is color-converted separately. Blending of the objects in the destination color space changes the appearance.
Recommendation: Flatten the PDF files. If your PDF files contain RGB data, it is highly recommended to Color-Convert this data prior to flattening. Please refer to Partner Place Answer ID 72326 for best practices and setting up a 2-Step refine.
Note: Contone proofing cannot be used to predict this issue when colormatching is performed on final output.
- ColorMatch vector overprint handling of certain files with transparency groups that also use overprint management can generate unexpected results. The new objects generated by the ColorMatcher vector overprint handling process end up ruining the appearance. Contone proofing with raster overprint handling cannot be used to predict the problem with vector overprint handling used on final output. See the Prinergy help for detailed descriptions about the processing differences between raster and vector overprint handling.
Recommendation: Flatten the PDF files. If your PDF files contain RGB data, it is highly recommended to Color-Convert this data prior to flattening. Refer to Answer ID 72326 for best practices and setting up a 2-Step refine.
- RGB Transparency Blend Color Space is not supported. Blend spaces should only be defined as DeviceCMYK.
Recommendation: Change the blend space in the input file or set up a Preflight+ profile to detect and/or fix the condition.
- ColorConvert is automatically selected in Vector Output process templates after you upgrade to Prinergy 8.3. This is due to a migration script bug. If you have a Basic License which doesn't enable ColorConvert, vector output will fail. If you are licensed for advanced Color Management, Color Conversion will be applied at output and may cause incorrect output. [PRINERGY-42167]
Workaround: open any Vector Output process templates which should not have ColorConvert enabled and clear the **ColorConvert** checkbox.

Preflight+

- When upgrading to Prinergy 9.0 from 7.5.x, 8.0.x, or 8.1.x Custom Checks and Fixups will not be migrated as their own entities. However, profiles referencing Custom Checks and Fixups will have been updated to incorporate the Custom Checks and Fixups; meaning, they will continue to work as they did prior to upgrading.
- callas process plans and profiles that create layers or contain unlicensed DeviceLinks are not supported.
- Kodak does not support or provide a license of callas pdfToolbox software. However, a copy of pdfToolbox (Preflight+ Profile Manager) is provided and licensed solely for the purpose of editing and creating preflight profiles that are to be used within Prinergy. Modification of the license as well as changing or upgrading the version of callas pdfToolbox that is provided with Prinergy is not recommended and not supported by Kodak. Kodak does not provide assistance or support for editing or creating new callas profiles. For information and support with the creation and editing of profiles, go to https://www.callassoftware.com/goto/tbx_ENG_documentation.
Note: Kodak does support issues related to the integration of callas preflight within Prinergy Workshop.

- Overview reports contain information from all pages in a multi-page PDF input file. When you open the report, it may contain information about pages you haven't selected.
- Report Page links are supported only when you copy the full report.
- callas fix-ups are "use at own risk". Exercise extra caution and check your proofs closely when applying fix-ups.
- callas Profiles and Prinergy support different variations of the Chinese character set.
 - Simplified = ZH_CN (callas) = PRC
 - Simplified = ZH_Hans (Prinergy) = South East Asia and Singapore
- callas template-based reports via PDFToolBox are not available in Preflight+ in Prinergy.
- Because each PDF report contains a full copy of the original input PDF file, using Preflight+ may result in higher demands on storage space in your job home disks.
- To avoid Preflight+ becoming a bottleneck in the Refine process, it is advised to purchase the same amount of Preflight+ JTPs as Refine JTPs.
- The use of variables that prompt users for input are not supported.
- New Libraries for organizing Checks and Fixups into categories.

Note: Profiles with Devicelink, Javascript and Variables are not supported.
- The "Test" function seen when creating new profiles is not supported

Adobe PDF Print Engine

The Adobe PDF Print Engine (APPE) RIP cannot process PDF files containing embedded PostScript objects, including pages that were processed with PostScript bypass or with the OPI bypass features of Prinergy.

The APPE RIP is the preferred RIP for Prinergy.

As of APPE 4.7 a maximum of 123 spots colors is supported (in addition to the four CMYK process colors, for a total of 127 colors).

Observe the following precautions:

- Proofs and plates: In plating jobs with the APPE RIP, be careful with plates that were proofed with the previous APPE RIP. Because the RIPs are different, there is a slight chance of an interpretation difference between proof and plate. Ideally, jobs should be plated with the same version of Prinergy that was used to generate the proofs.

Note: To avoid this situation you should coordinate hub and spoke configurations when upgrading Prinergy.
- Reprints: For reprints of jobs that were printed previously using an older RIP, it is recommended that you rerun proofs using the new RIP to ensure there are no unforeseen differences between the original press run and the reprint.

PANTONE+ V3 libraries

In keeping with PANTONE best practice guidelines, all previous PANTONE libraries have been removed as factory libraries and will no longer appear in your process templates. Previous Prinergy PANTONE libraries are provided in archive format and can be imported as user libraries, if desired, for legacy reprint jobs. For more details, see [About PANTONE libraries](#).

Maxtone CX, Maxtone FX, and Maxtone SX RIP

Kodak Maxtone CX, Maxtone FX, and Maxtone SX screens are available for APPE RIP only. They are not available for use with CPSI RIP.

System spot color library L*a*b* 2000

When system spot color library L*a*b* 2000 is added to a refine process template, it may not appear in the spot color libraries list but it will be available to be used by refine processes created from the refine process template. [PRINERGY-44022]

Refine to PDF/x-1a fails when Lab Spot Color Libraries are loaded and you are NOT converting Spots

As of Prinergy 8.0, all factory Spot Color libraries were replaced with Pantone V3 Lab libraries. If you refine a file that contains a Spot Color that is defined in the Lab library, the Spot Colors Alternate Color Space will change to Lab. Since Lab is not allowed in PDF/x-1a, the process will fail.

To resolve this, you can remove the PANTONE V3 library or load a CMYK library, such as a legacy user or ColorBridge library (Answer ID 73041).

Note: If your incoming PDF has Spots with LAB Alternate Color space, you will want to have a CMYK Pantone library loaded, otherwise refine will also fail.

When converting Spots to Process, its recommended to use the new PANTONE V3 Library. See the About Pantone Libraries section of the Workflow Help for more information. [PRINERGY-43630]

Selecting "Replace variable marks in PDF content files" causes incorrect overprints on some objects

When using this setting you must follow the procedure outlined in Partner Place Answer ID 69302. Failing to do so could result in serious Output problems.

Additional Register JTPs configured to run on a secondary server are incorrectly homed on the primary server after restart

[Prinergy-34180]

Windows Server 2016 and 2019 operating systems

The following limitations have been identified when running Prinergy using the Windows Server 2016 and 2019 operating systems:

- Not all legacy Kodak computer-to-plate (CTP) devices have controlled release software that is compatible with Windows Server 2016 and Windows Server 2019. Contact your Kodak representative to confirm if your CTP device has a compatible controlled release software available.

Limitations with SMB 2 and SMB 3 on Windows Servers in mixed environments

- By default, Prinergy servers running Windows Server 2016 and Windows Server 2019 are shipped with SMB 2 and 3 enabled.

- For best performance, all Prinergy servers and tertiary servers should be running the same operating system version. If any of the tertiary servers are not running at least Windows Server 2012 R2, SMB 2 and 3 need to be disabled so that SMB 1 is used. If this is not done, this can cause performance and file access/transfer issues. For assistance in disabling SMB 2 and 3, contact your local support representative.

Network File System connectivity

Prinergy does not support The Open Group UNIX NFS (Open Group UNIX Network File System). You can access UNIX servers using an SMB/CIFS protocol installed on the server (such as SAMBA).

NexPress Job Ticket Editor cannot be launched by Digital Submit on Windows 10

When running Digital Submit with NexPress on Windows 10, the Job Ticket Editor in Digital Submit fails to launch. [PRINERGY-41688]

Workarounds: To launch the NexPress Job Ticket Editor:

- Run Digital Submit and NexPress Job Ticket Editor on a workstation with a different operating system
- Manually launch the NexPress Job Ticket Editor outside Digital Submit.

HP Job Ticket Editor cannot be installed on Windows 8 and Windows 10

The HP Job Ticket Editor is software available from HP which is used in Prinergy Workflow when connecting to HP digital presses. The latest version of the software available from HP is not compatible with Windows 8 and Windows 10 operating systems. HP is aware of the issue and will address it in a future product update. [PRINERGY-41575]

HP

- When using a Hewlett Packard SmartStream DFE connected to multiple presses, each press connected to the SmartStream DFE consumes a connection license from Prinergy Workflow. If you have more presses connected to the SmartStream DFE than you have licenses for connections in Prinergy Workflow, Prinergy will not be able to connect with all presses connected to the SmartStream DFE. [PRINERGY-44364]
- If you try to import substrates and/or reload device capabilities (in Setup > **Equipment** > **Digital Device**) from a connected press or DFE while this device is down, the substrates and/or device settings will no longer be visible in the Digital Job Ticket Editor when you submit a job. Once the device is up and running, you must re-import the substrates and/or reload the device capabilities so that they are visible again in the Digital Job Ticket Editor. [PRINERGY-44749]
- HP DFE with multiple connected presses does not recognize Prinergy server by its name. Make sure the Prinergy server name is correctly resolved on the DFE. For a DFE running on Windows, add the Prinergy host name and IP address in C:\Windows\System32\drivers\etc\host [PRINERGY-45428]

Ricoh

- Perfect bound jobs with covers sent to Ricoh digital front end with PDF RIP Enhanced by Kodak type S4 may result in output with incorrect orientation. [PRINERGY-42077]

- Due to limitations in JDF implementation for Ricoh digital front end with PDF RIP Enhanced by Kodak type S4, layout options are not currently supported. [PRINERGY-39050]
- When sending a surface to Ricoh, the binding edge defined in the job will rotate 90 degrees clockwise due to geometry translation, but the end result of the output at the printer will be correct. If you have questions, contact your Kodak representative for assistance. [PRINERGY-42029]
- Jobs printed successfully move to On Hold queue rather than Completed queue in Device Track. This is a known Ricoh bug. [PRINERGY-45100]

Konica Minolta

The status of coated or uncoated stock may not be imported or reflected correctly in Prinergy Setup for digital connections to Konica Minolta IC-602 or C1070 digital printer front end software. Job settings may need to be manually updated in the Konica Minolta software to complete output successfully. [PRINERGY-43211]

EFI

- Due to a limitation in the bi-directional communication with EFI's software, completed jobs are do not appear in Prinergy Workflow's Device Track **Completed** queue and are not present in any queues upon completion. [PRINERGY-43780]
- Due to an EFI issue with bi-directional connectivity, Prinergy Device Track displays incorrect number of inks. [PRINERGY-46698]
- Due to a known EFI process with legacy JDF connectivity, jobs are not printed directly, but go to the **On Hold** queue first. [PRINERGY-46646]

Prinergy Workshop localized to Japanese

Submitting a file to Prinergy Workshop localized to Japanese via drag and drop to a process template may cause Workshop to quit unexpectedly. [PRINERGY-43660]

Prinergy Signature Select Limitations

Prinergy Signature Selection works in Preps 5 mode. Therefore, there are several limitations related to working with Preps 6 or later.

Editing impositions

- It is not possible to edit come-and-go, cut-and-stack, and multibinding style jobs with Signature Selection. If you try to edit an imposition that uses any of these styles, the **Use Prinergy Signature Selection** option will not be available in the Edit Imposition dialog box. Instead, you will be able to select **Use External Imposition Application** to start Preps.
- If you create a come-and-go or cut-and-stack imposition using Signature Selection, and then edit the imposition using Preps 6 or later, a warning message appears, indicating that the job was produced in an earlier version of Preps. You can ignore this message.

Importing Impositions

- Signature Selection does not support import of Preps 6 jobs with come-and-go or cut-and-stack binding styles. When creating a new imposition, if you select **Use existing Preps job** and select a Preps 6 job with a come-and-go or cut-and-stack binding style, an error

message appears. You have the choice of selecting a different job file or using external imposition software to create the imposition.

Creating Impositions

- When you create a new imposition, the come-and-go or cut-and-stack binding styles are available in Preps 5 mode only.
- Preps 5 and 6 differ in the way that they display cut-and-stack and come-and-go jobs. In Preps 6, cut-and-stack jobs are shown as multiple webs, and come-and-go jobs are shown as multiple sections. In Prinerger Workshop, such jobs are displayed in the Preps 6 format, while in Signature Selection, they are displayed in the Preps 5 format. This is just a difference in display. The page assignment is correct and the imposition will print correctly.

Auto Select in Prinerger Signature Selection

The use of Auto Select in Prinerger Signature Selection may produce different results from the use of Auto Select in Preps. Check that Auto Select produces the expected results.

If required, you can use **Move Up** or **Move Down** to adjust the signature order, or use **Add** or **Delete** to get the right signature.

To prevent the problem, edit the `PrepsPrinerger.cfg` and the `PrepsPrinerger.cfg.template` files to include the line:

```
AUTOSELECT_MINIMUM_PAGES:1.
```

Re-editing imposition of imported job may not work in certain cases

Re-editing a Preps imposition from Workshop may not work for certain imported jobs. If the imported job contains an imposition name that is greater than 25 characters and had an imposition that was previously edited and the older version was deleted. To prevent this issue when editing existing impositions always choose the import option to "Keep existing imposition". [PRINERGY-50121]

RBA

Rules Based Automation (RBA) may not start after upgrading to Prinerger Workflow 8.1.2 or later. To address this issue, if encountered, see Partner Place answer [73601](#).

Creating Jobs Fails After Downgrading to Prinerger Workflow 8.1.2 from Prinerger Workflow 9.0

If a downgrade to Prinerger 8.1.2 is required after upgrading to 9.0.0, errors may be encountered with creating jobs in the downgraded 8.1.2 server.

If you encounter this problem, contact your Kodak service representative to address the issue with your Prinerger system. [PRINERGY-46987]

Setup fails after downgrading to Prinerger Workflow 8.1.2 from Prinerger Workflow 9.0.0

After downgrading from Prinerger 8.4.0 to Prinerger 8.1.2, Setup needs to be re-installed to function correctly. [PRINERGY-48872]

McAfee 10.5.3 / 10.6 on Windows 2016 with Windows Defender

McAfee 10.5.3 / 10.6 cannot be installed and run on Windows 2016 if Windows Defender is installed. This is a limitation of the McAfee anti-virus software that requires Windows Defender to be uninstalled on systems you wish to install McAfee on. [PRINERGY-48947]

Adding an output device in Prinergy Administrator may not work

The first time you attempt to add an output device in Prinergy Administrator after restarting the server Prinergy is running on, Prinergy Administrator may crash. You will be able to add the device successfully after restarting the Prinergy Administrator interface.[PRINERGY-48874]

Acrobat 2017 and 2020 Support

Acrobat 2017 and 2020 are one-time purchase release updates of Acrobat DC (similar to the original Acrobat 2015 release). The Prinergy Workshop installer does not detect the folder location for Acrobat 2017 or 2020. If you are using the version of Acrobat DC that is sold and labeled as Acrobat 2017 or 2020, you will need to manually install the Acrobat DC plugins in Acrobat 2017 or 2020.

See Partner Place Answer ID 74309 for plugins and manual installation instructions.

Export Job

Exported jobs from Prinergy 9.x that contain Preflight+ XML reports cannot be imported into Prinergy 7.x.

Page Aliases

Copy job does not keep page alias assigned to pageset when copying jobs on the same server or between servers. [PRINERGY-49619]

Workshop Visible Columns

Dynamic Visible columns shift position (eg: move to the right or left). [PRINERGY-52293]